

Work Order ID 159940

Wednesday, April 19, 2017 3:28:15 PM

159940

Page 1

Item ID: D412-664-203TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 5/2/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/12/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/S

Approvals: Process Plan:

DAS
21
9-39

Date: APR 20 2017

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D412-664-243	F

100

0.36

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

1.14

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs 412-203 on both ends as per Folio FA166
2-Face both sides of tube
3-Turn first taper section on both side as per Folio FA166
4- blend transition lines using belt sander with 60 grit sandpaper
FOLIO REV: AA
DWG REV: F

1 ϕ PMP
24-07-2017DAS
23
9-89

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

1 ϕ PMP
24-07-2017DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 159940

Wednesday, April 19, 2017 3:28:15 PM

159940

Page 2

Item ID: D412-664-203TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 5/2/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 5/12/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/S

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00				1	0		PMP 24-07-2017
120 Mori Seiki	Memo	2.39							
Mori Seiki CNC Lathe Large	1-Turn second taper on both sides as per Folio FA166 2- Blend transition lines using belt sander with 60 grit sandpaper. 3- Remove sand and plugs 4-Scribe part # and batch # using vibrating stilus FOLIO REV: <u>AA</u> DWG REV: <u>F</u>								
130	QC2- Inspect parts off machine FAI/FAIB	0.00				1	0		PMP 25-07-2017
130 QC	Memo	0.00							
Quality Control	+ PERFORM ULTRA SONIC MEASUREMENT								
140	QC8- Inspect parts - second check	0.00				1	0		DAS 47 9-89 17-07-20
140 QC	Memo	0.02							
Quality Control	+ CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐									
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval							
Description Work Order Deviation		Disposition		Completed By							
				Lead hand / Supervisor Approval Verification							
				QC / QA Coordinator Approval							
Root Cause <table style="width: 100%;"> <tr> <td style="width: 50%;"> Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ </td> <td style="width: 50%;"> No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐ </td> </tr> </table>		Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	FAULT CATEGORY <table style="width: 100%;"> <tr> <td style="width: 33%;"> Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ </td> <td style="width: 33%;"> Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ </td> <td style="width: 33%;"> Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ </td> <td style="width: 33%;"> Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐ </td> </tr> </table>				Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐										
Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐								
OTHER : _____											

Wednesday, April 19, 2017 3:28:15 PM

159940

Page 3

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 5/2/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 5/12/2017 **Req'd Qty:** 1.00 ***1***

Customer:

Reference: SCHEDULED/S

Run Start *NR1*

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Stop ***NR2***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

145

0.00

145

1.22

Crosstubes

Memo

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

150

0.00

150

1.50

HandFXtube

Memo

1- PRESSURE WASH X-TUBE INSIDE AND OUT

Hand Finishing Crosstubes

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

160

QC7-Inspect Chemical Conversion Coat

0.00

160

0.01

QC

Memo

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
☐ Environment	☐ Design	☐ Doc/Data	☐ Equip/Tooling	☐ Handling/Pre	☐ Material	☐ Internal Transport	☐ Tribal Knowledge
☐ No Re-verification	☐ Operator	☐ Offset/Setup	☐ Supplier	☐ Training	☐ Use for Testing	☐ Poor Information	☐ Rushing
☐ Pressure/Forced	☐ Bending	☐ Centre Not Concentric	☐ Cracks	☐ Crimp/Kink/Ripple/Wave	☐ Cuffs	☐ Crushing	☐ Heat Treat
☐ Temperature/Cure	☐ Set-up	☐ BOM/Route	☐ Broken/Damage/Defect	☐ Inspection Incomplete/Unqualified	☐ Contamination	☐ Countersink	☐ Cut Too Short
☐ Power Loss/Surge	☐ Folio/Program	☐ Grain	☐ Weld	☐ Wrong Stock Pulled	☐ Out of Sequence	☐ Off-set	☐ Mislabeled
☐ Positioned Wrong	☐ Outside Dimensions	☐ Over/Under tolerance	☐ Part Incorrect	☐ Part Lost/Missing	☐ Part Moved	☐ Drawing	☐ Finish
☐ Misread	☐ Turning Sequence						
☐ Past Expiry Date	☐ Misidentified	☐ Past Due	OTHER : _____				

Work Order ID 159940

Wednesday, April 19, 2017 3:28:15 PM

159940

Page 4

Item ID: D412-664-203TRN**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Crosstube Turning Detail**Start Date:** 5/2/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 5/12/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED/S**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	LOCATION : LG014								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.10							
Quality Control									

OP2 17-08-28

17/9/5 97

DAS
21
9-89

AUG 28 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Picklist Print

Wednesday, April 19, 2017 3:28:15 PM

Page 1

Work Order ID: 159940

159940

Parent Item: D412-664-203TRN

D412-664-203TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 5/2/2017

Required Date: 5/12/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:eec
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			120	Each	70.0000	1	1			

D6009-129

**

Crosstube Material

Location	Loc Qty	Loc Code
LG003	26	
123972	23	
123974	3	
SHED	44	
139424	44	

PMP

24-07-2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
				OTHER : _____			


DART AEROSPACE LTD		Work Order: 159940
Description: Crosstube Assembly (412 High Aft)		Part Number: D412-664-243
Inspection Dwg: D412-664-243 Rev: F		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.689	✓		VERN 08	
	2.748	+0.005/-0.000	2.753	✓			
	2.884	+0.005/-0.000	2.889	✓			
	3.019	+0.005/-0.000	3.024	✓			
	3.163	+0.005/-0.000	3.165	✓			
	3.308	+0.005/-0.000	3.313	✓			
	3.429	+0.005/-0.000	3.433	✓			
	2.990	+0.005/-0.000	2.995	✓			
	2.618	+0.005/-0.000	2.623	✓			
	0.200	+/-0.010	.205	✓		VERN 08	
	R0.063	+/-0.010	.063	✓		R.G.	
	R0.500	+/-0.010	R.500	✓		R.G.	
	4.971	+/-0.030	4.975	✓		VERN 08	
SIDE B	2.684	+0.005/-0.000	2.688	✓		VERN 08	
	2.748	+0.005/-0.000	2.750	✓			
	2.884	+0.005/-0.000	2.886	✓			
	3.019	+0.005/-0.000	3.021	✓			
	3.163	+0.005/-0.000	3.164	✓			
	3.308	+0.005/-0.000	3.311	✓			
	3.429	+0.005/-0.000	3.431	✓			
	2.990	+0.005/-0.000	2.993	✓			
	2.618	+0.005/-0.000	2.622	✓			
	0.200	+/-0.010	.205	✓		VERN 08	
	R0.063	+/-0.010	.063	✓		R.G.	
	R0.500	+/-0.010	.500	✓		R.G.	
	4.971	+/-0.030	4.975	✓		VERN 08	
	124.100	+/-0.020	124.100	✓		TAPE	

DART AEROSPACE LTD		Work Order: 159940
Description: Crosstube Assembly (412 High Aft)		Part Number: D412-664-243
Inspection Dwg: D412-664-243 Rev: F		Page 2 of 2

WALL THICKNESS MEASUREMENT

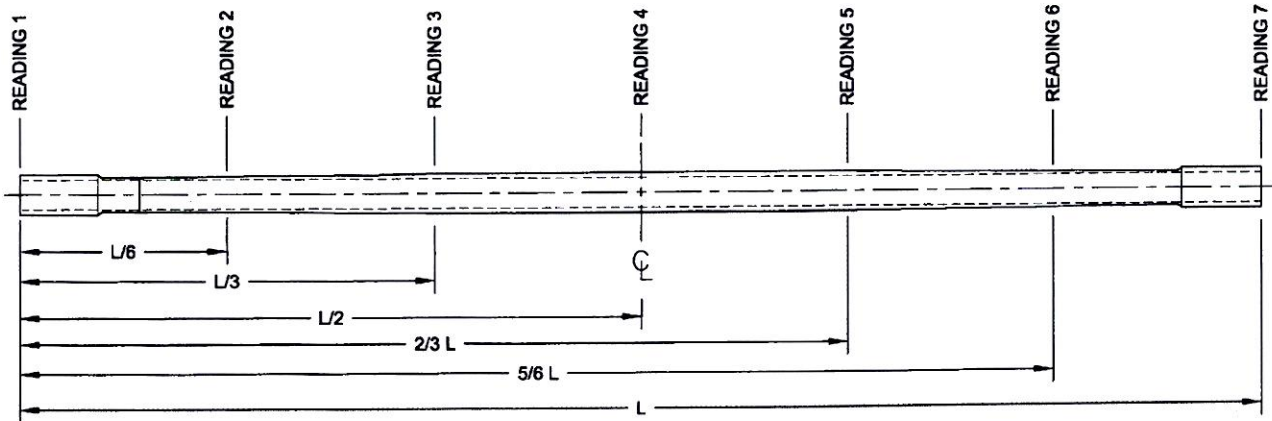

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.352	.383	.380	.359	.031	0.073"
READING 2 L= 20.683	.291	.323	.325	.301	.034	
READING 3 L= 41.367	.460	.490	.482	.467	.030	
READING 4 L= 62.050	.616	.629	.614	.616	.015	
READING 5 L= 82.733	.471	.499	.465	.456	.043	
READING 6 L= 103.417	.292	.343	.321	.283	.060	
READING 7 L= 124.1	.358	.391	.373	.364	.033	

Calibration Result

Actual Block Thickness: 100-750

Sitiescan 250 Measured Thickness: 100-750

Measured by: PMP	Audited by: DAS 47 9-89	Preliminary Approval:
Date: 25-07-2017	Date: 17-07-28	Date:

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	
E	12.06.04	Wall thickness form added	KJ	
F	14.06.24	Dwg Rev updated	KJ	

Item	Qty	Part Number	Description
	-243		
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890 B-2	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING)
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: DART P/N "D412-664-243" AND B/N ON INSIDE OF CUFF PER QSI 044 6.4 (VIBRATING STYLUS)
- WEIGHT: 47.0 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. DO NOT GRIND TUBE AFTER SHOT PEEN.

TURNING

- WHEN TRANSITIONING TO STOCK MAT'L, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R30 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 159940 MWS


1704-20

RELEASED
2014-05-26


F	NOTES RE-ORDERED, SCOTCH-WELD WAS MAGNOBOND (C8-1), ADD CLAMP RETORQUE (A8-1), REMOVE ABRASION STRIP, ADD INSPECTION WINDOW (C8-1), CHAFING SHIELD NOW 4.38 WIDE (C8-2), ADD 7% CRUSHING (B8-1), CHG BEND HEIGHT TOL. TO ±0.25 (C1-3), CHG CUFF TOL. (D2-4), CLAMPS FLIPPED TO PREVENT CHAFING (B7-2, B7-3), INCORP. DEO E-2/4	CP	14.04.01
E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #8 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATIBILITY WITH BHTAA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D412-664-243 REV. F SHEET 1 OF 4 TITLE CROSSTUBE ASSEMBLY (412 HI AFT) SCALE NTS COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCIAL OR CONSUMER TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

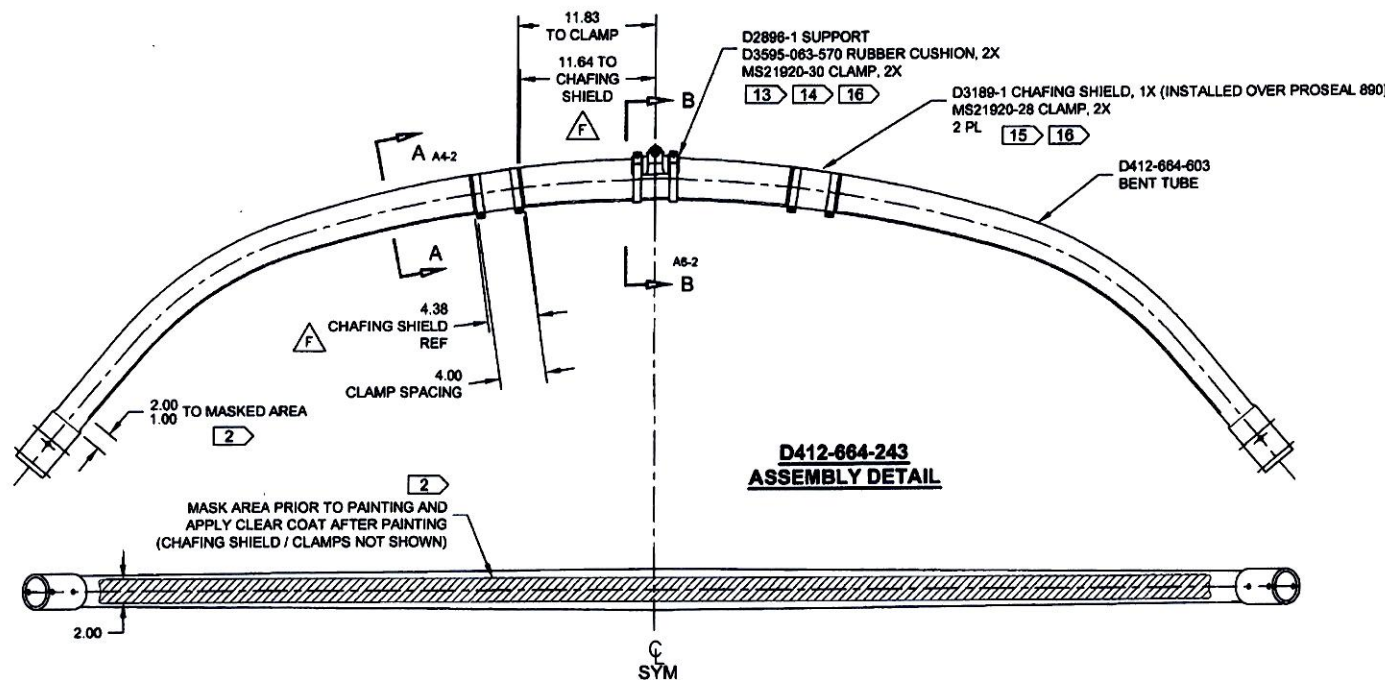

**D412-664-243
ASSEMBLY DETAIL**

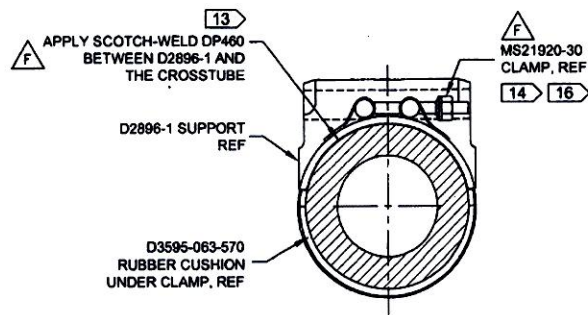


**SECTION B-B D4-2
SCALE 4X**

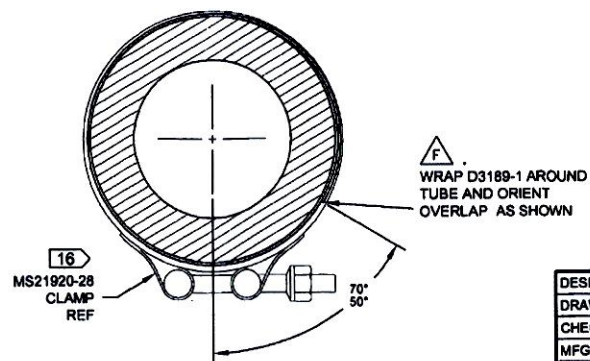



**SECTION A-A D6-2
SCALE 6X**

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D412-664-243	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

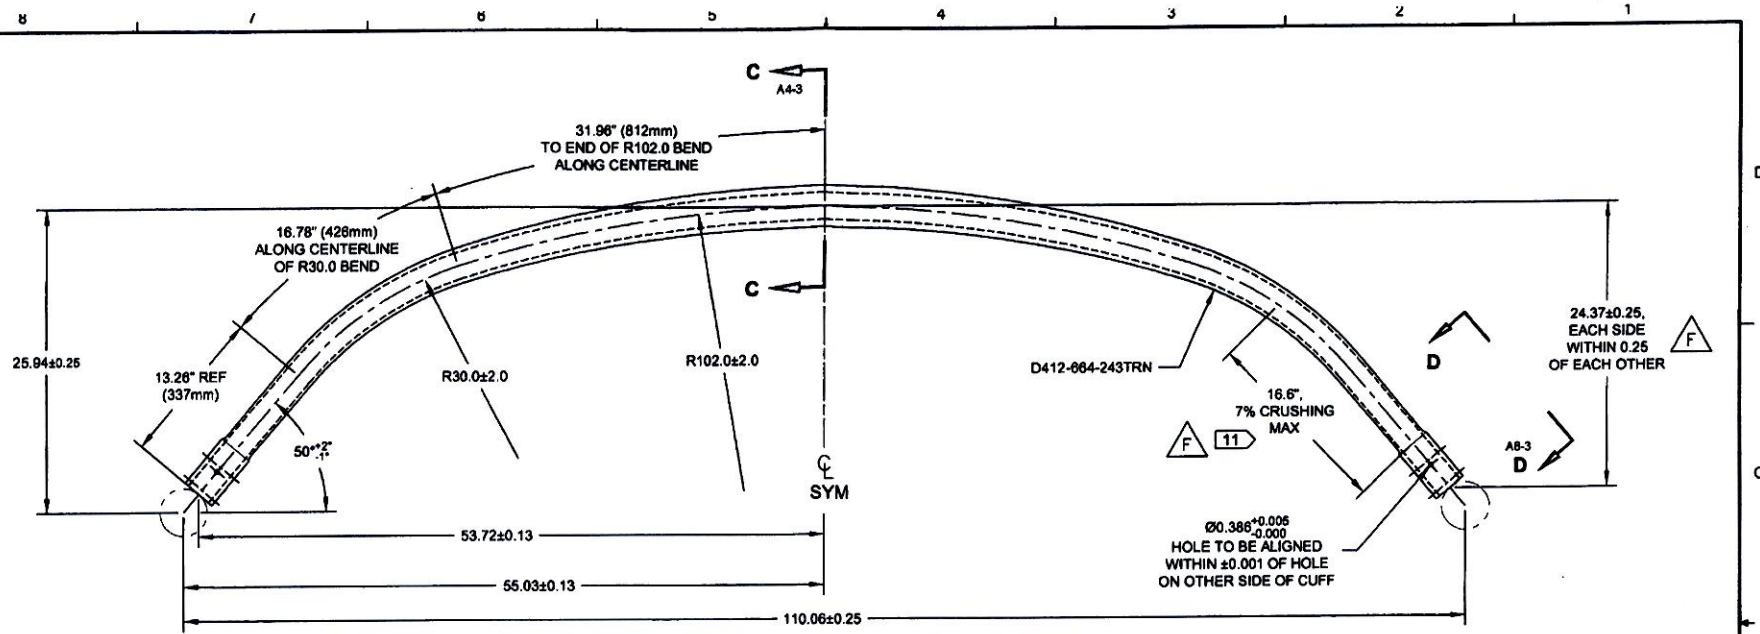


D412-664-603
BENDING AND DRILLING DETAIL

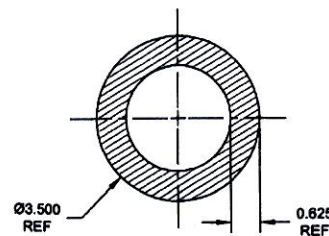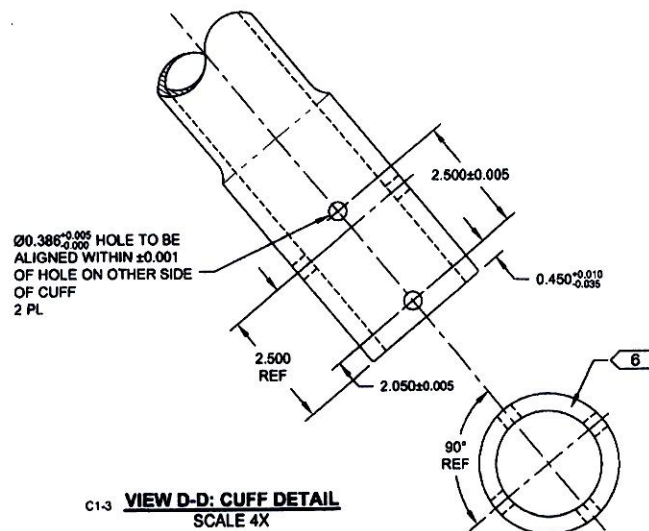


RELEASED
2014-05-26


DESIGN	<i>90</i>	DART AEROSPACE LTD	
DRAWN	<i>90</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>DW</i>	DRAWING NO.	REV. F
MFG. APPR.		D412-664-243	SHEET 3 OF 4
APPROVED	<i>MD</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

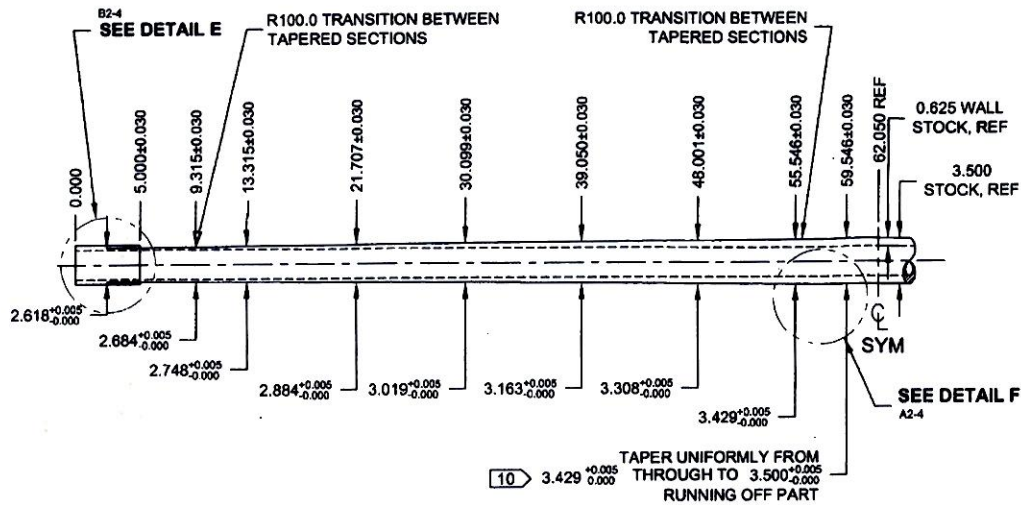


**D412-664-243TRN
TURNING DETAIL**

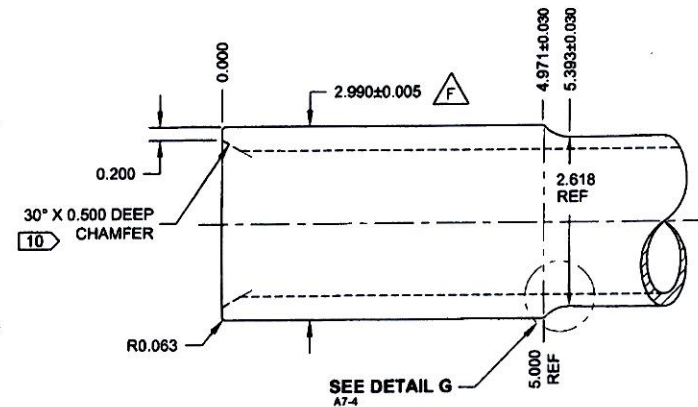

**DETAIL E:
CROSSTUBE CUFF** D6-4
SCALE 5X

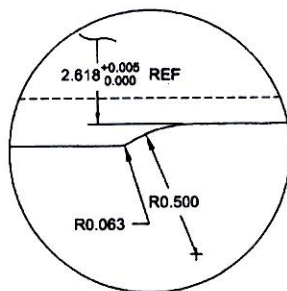

**DETAIL G:
CUFF TRANSITION** C2-4
SCALE 10X

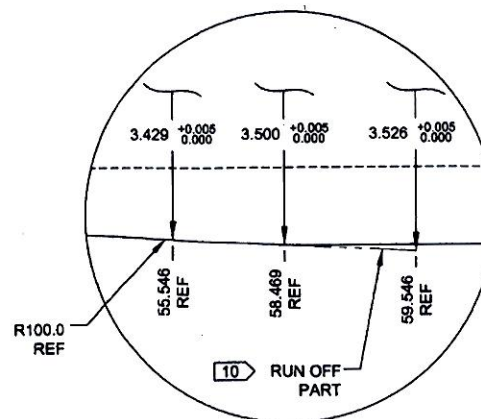

**DETAIL F:
TAPER RUN-OFF** C4-4
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	<i>g</i>	DART AEROSPACE LTD	
DRAWN	<i>g</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>W</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>W</i>	D412-664-243	SHEET 4 OF 4
APPROVED	<i>W</i>	TITLE	SCALE
DE APPR.	<i>W</i>	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	